


Document ID: 2170208

# #06-08-57-002C: Rear Window Waterleak (Apply Sealer to Convertible Top) - (Jul 21, 2008)

**Subject:** Rear Window Waterleak (Apply Sealer to Convertible Top)

**Models:** 2006-2009 Pontiac Solstice  
 2007-2009 Saturn SKY  
 2007-2009 Opel GT

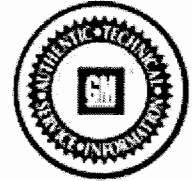

**This bulletin is being revised to update the models and model years. Please discard Corporate Bulletin Number 06-08-57-002B (Section 08 - Body and Accessories).**

## Condition

Some customers may comment on a waterleak from the rear window.

## Cause

This condition may be caused by the convertible top material separating from the back window.

## Correction

To repair this concern, clean the surfaces with \*3M™ General Purpose Adhesive Cleaner. Then apply \*3M™ Urethane (High Viscosity) Sealer, P/N 08609, between the two surfaces and let cure following manufacturer's recommendations.

\*We believe this source and their products to be reliable. There may be additional manufacturers of such products. General Motors does not endorse, indicate any preference for or assume any responsibility for the products from this firm or for any such items which may be available from other sources.

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
B9781*	Reseal Back Glass	0.5 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, it is not intended to be a repair procedure. All rights reserved. © 2009 General Motors Corporation.

WE SUPPORT VOLUNTARY